

(A1)

**- Automatic transmission 722.9 in limp-home mode, fault codes
2200, 2201, 2767, 2768 -**

Topic number	GI27.50-P-035556
Version	5
Design group	27.50 Gear assembly
Date	02-19-2009
Validity	Transmission 722.9
Reason for change	Validity changed

Complaint

Automatic transmission 722.9 switches to limp-home while driving (gearshifts no longer possible); one or more of the following fault codes are stored or current: 2200, 2201, 2767, 2768

Cause

Rpm sensor fault

Remedy

Replace electrohydraulic controller unit (EHS).

Symptoms

Symptom

Power transmission / Automatic transmission / Automatic transmission - function / Limp-home mode

Power transmission / Automatic transmission / Automatic transmission - function / Electrical fault/Fault code

Operation numbers/damage codes

Op. no.	Time	Damage code	Note
		Operation text	

27-4989

5337673

Rpm sensor fault on EHS replacement

EHS REPLACEMENT

Validities

Vehicle	Engine	Transmission	Major assembly (1)	Major assembly (2)	Major assembly (3)
*	*	722.902	*	*	*
*	*	722.998	*	*	*
*	*	722.961	*	*	*
*	*	722.907	*	*	*
*	*	722.901	*	*	*
*	*	722.904	*	*	*
*	*	722.950	*	*	*
*	*	722.960	*	*	*
*	*	722.966	*	*	*
*	*	722.930	*	*	*
*	*	722.906	*	*	*
*	*	722.964	*	*	*
*	*	722.962	*	*	*
*	*	722.999	*	*	*
*	*	722.903	*	*	*

 Show full validity description