

SI27.19-P-0009A	Service information: Conversion of electrohydraulic actuator (EHS) on automatic transmission (A/T)	20.1.10
-----------------	--	---------

TRANSMISSION 722.9 in MODEL 204.022 /052 /054 /056 /077 /081 /085 /087 /089 /222 /252 /254 /256 /277 /981 /983 /987 up to 1.7.08

TRANSMISSION 722.9 in MODEL 216.371 /377 /386 up to 1.7.08

TRANSMISSION 722.9 in MODEL 221.022 /028 /054 /056 /070 /071 /077 /080 /084 /086 /087 /122 /128 /154 /156 /170 /171 /177 /180 /184 /186 /187 up to 1.7.08

**i** In the event of shift quality complaints on the above listed models, it is currently forbidden to replace the electrohydraulic actuator (EHS).

After replacing and commissioning the EHS, customer complaints can occur with the cruise control (CC), DISTRONIC (adaptive cruise control) and hold function.

Work is currently being carried out on a remedy for complaints relevant to the function (hardware faults on rpm sensor, control unit or EHS).

A solution is provisionally available via the Xentry Diagnostics Version 03/2010.  
 Please contact the customers as soon as this is available.  
 Damage code: 27401B2.  
 Only the models listed with the EHS part numbers listed below may be affected, the EHS part number should be checked in the individual case:  
 A 220 270 13 06  
 A 220 270 18 06  
 A 220 270 19 06  
 A 220 270 21 06  
 A 220 270 22 06