
DaimlerChrysler

annierChrysler India Private Limited

Pune, October 22, 2003

Kind Attention - Workshop Managers:

- Cama Motors, Ahmedabad
- Trans Cars, Chennai
- T & T Motors, New Delhi
- Adishwar Auto, Hyderabad
- Sanghi Motorcar Co., Mumbai
- Auto Hangar, Mumbai
- Patel Auto Services
- Sundaram Motors, Chennai

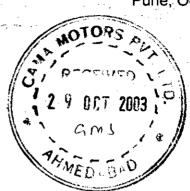

Service Measure - Check for cover under air inlet slot on engine hood and retrofit if Necessary - Model W 203

Dear All.

We are in receipt of a subject service measure from DCAG. The details of the vehicles in your responsibility is attached herewith. The vehicles where the concerned dealer could not be identified are also included in the list. If such a vehicle reports to your dealership, then please carryout this action otherwise provide us a written confirmation that the vehicle does not report to your workshop.

As per the details received from DCAG, on the above mentioned vehicles a cover under the air inlet slot of the hood may not have been installed. Please check whether this cover is present on the vehicle's next visit to workshop. If the cover is not installed, please retrofit the cover as per the work instruction attached herewith.

Operation texts and flat rates:

Operation no. Flat rate Operation text

Retrofit cover over brake fluid reservoir 0.5 hrs. 02 - 3999

Qty. per vehicle Parts description A 203 830 16 13 05 Cover A 002 988 05 42 05 Clip A 203 831 01 14 05 **Bracket** Cont.....2

India Private Limited. Registered Office, Corporate Office & Works: Sector 15-A, Chikhali Village, Pimpri, Pune 411 018 (India)

Phone: (+91) 20 7470810

'tanaging Director & CEO: (+91) 20 7477257, Marketing: (+91) 20 7478222, Production: (+91) 20 7478780, Finance and Controlling (+91) 20 7478748. Corporate Affairs: (+91) 20 7473597, Human Resources: (+91) 20 7473618

Damage code

0 88920467

A warranty/goodwill claim for the costs of labour and material (if any) may be submitted to us, quoting the accounting number 8892046.

This service measure should be completed by the end of October 2004.

Please acknowledge receipt of this letter and feel free to contact us if you have any queries.

With best regards,

DaimlerChrysler India Private Limited

D.Chandavarkar Divisional Manager Field Service

Devendra Thakur Sr. Manager Customer Service

Encl. – Work Instruction Véhicle List

Work description for service measure at next workshop stay

Check cover under the air inlet slits on the engine hood and retrofit if necessary. Model W 203 RHD

Procedure

- 1. Open engine hood as described in AR88.40-P-1000M.
- 2. Visually inspect to see if a cover is installed on top of the brake fluid reservoir. If this is **not** installed (see Figure 1), continue with step 3. If the cover is installed (Figure 2), no work needs to be performed.

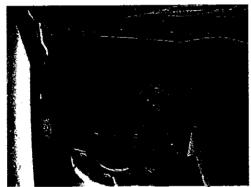


Figure 1
Cover not installed



Figure 2
Cover installed

3. Remove rubber seal (Figure 3) from the partition wall and mount (Figure 5) bracket (Figure 4). Reattach rubber seal.

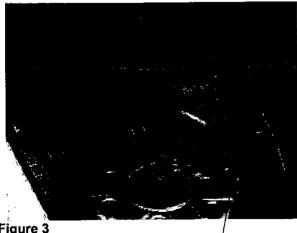


Figure 3
Rubber seal on partition wall



Figure 4 Bracket



Figure 5
Bracket mounted to partition wall

4. Guide the cover (Figure 6) into the bracket. Mark the position of the right interlocking hole. Cut out the interlocking hole (Figure 7). For this, it is recommended that you use a 7 mm drill bit to bore 2 holes right next to each other, then file them to an elongated hole.



Figure 6 Cover



Figure 7
Cut out hole

5. Guide cover into the bracket and lock onto the cover of the wiper linkage using a clip (Figure 8).



Figure 8 Clip

Parts

Qty.	Description		Part number
	· · · · · · · · · · · · · · · · · · ·		
1	Cover		· A 203 830 16 13
. 1	Clip		- A 002 988 05 42
1	Bracket		A 203 831 01 14

Operation text and flat rate

Operation no. rate	Operation text		Flat
02-3999	Check cover under the air inlet slits on the engine hood and retrofit if necessary.	0.5 hrs.	

DaimlerChrysler AG Global Service & Parts