

Recd-on 5/7/2007

DAIMLERCHRYSLER

DaimlerChrysler
India Private Limited

Pune, July 02, 2007

*Jaswinder / Smith.
Pls. plan accordingly
to order the parts.
DJJ
6/7/07*

All Workshop Incharge
DC India dealerships / ASC

Service measure during next workshop visit
Replace seal at engine oil filler neck
Model 211 with OM 642 engine

Dear All,

On the vehicles mentioned in the attached list, a filler neck for the engine oil with an extended collar is to be installed. This action will ensure that the oil spilled when filling the engine oil does not run down the engine which in turn can cause a short circuit there through contact with the alternator, and thereby preventing the battery charging.

This work is to be carried out at the vehicles' next workshop visit. Please refer to the attached work instructions for the required steps. Please note that the locations mentioned in the list are only indicative and any vehicle mentioned in the list visiting your workshop has to be attended for this Campaign.

For operation texts, flat rates and spare part details, please refer to the attached work instructions.

Damage Code: 015910327

Cost settlement:

A warranty/goodwill claim for the costs of material and labor can be submitted quoting accounting number 1591032.

Completion deadline

This field campaign should be completed by **31st December 2008**.

Please advise your concerned staff accordingly and ensure that each vehicle (mentioned in the list) visiting your workshop is attended for this action.

..... 2

: 2 :

 
Please acknowledge receipt of this letter and feel free to revert to us for any queries.

Thanking you

With best regards,
DaimlerChrysler India Private Limited



D. Chandavarkar
Director
After-Sales



Ashish Salvi
Dy. General Manager
Field Service

Copy to - DCIPL Service Representatives } for close follow up with the workshops

Encl. - Work Instructions
- Affected vehicle list

WORK DESCRIPTION FOR SERVICE MEASURE

Code: 0611P15B21

Version: 2.0

Replace seal at engine oil filler neck
Model 211

Work Procedure

1. Remove engine cover and remove old seal (A) at engine oil filler neck opening (figure 1).

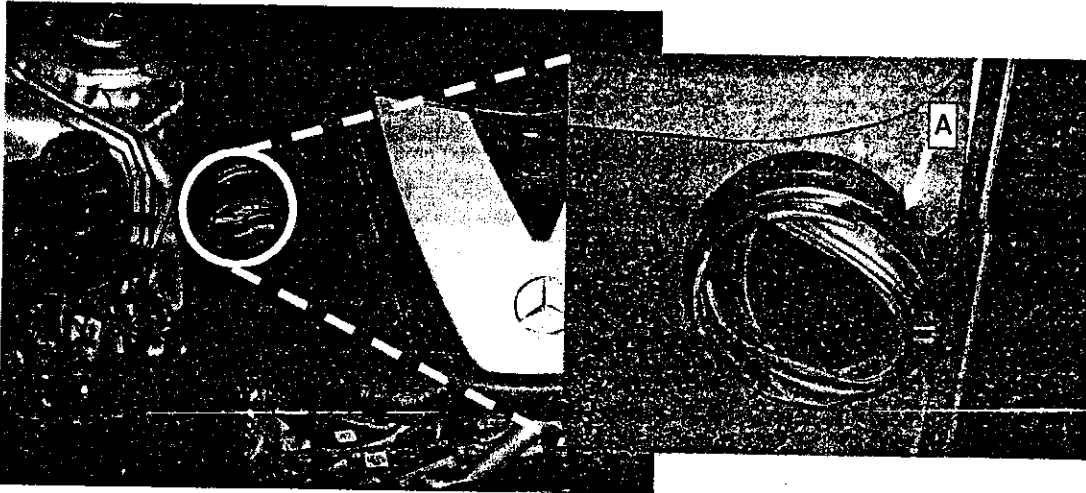


Figure 1

2. Install new seal (A) at engine oil filler neck (figure 2).


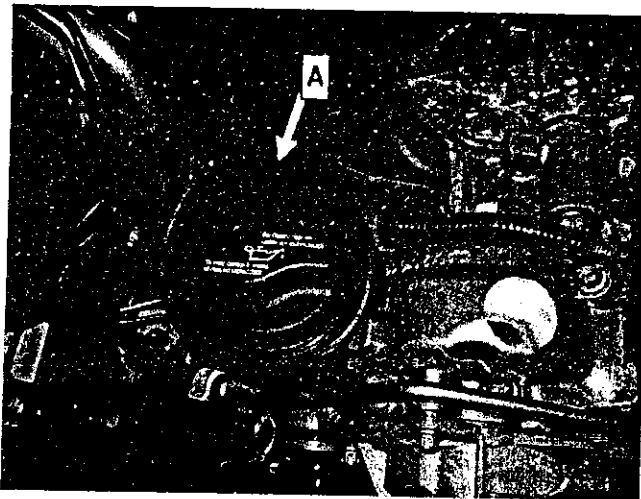


Figure 2

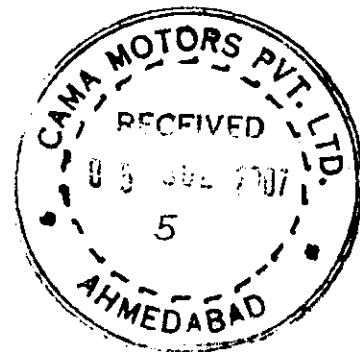

Parts

Quantity	Designation	Part no.
1	Seal	A 642 018 00 80 05

Operation Text and Flat Rate

Operation no.	Operation text	Flat rate	Accounting no.
02-5568-01	Replace seal at engine oil filler neck	0.1 h	15 910 32

DaimlerChrysler AG
Global Service & Parts