

Mercedes-Benz India Private Limited

Pune, November 13, 2008

Workshop Incharge
MB India Authorised Workshops

Service measure during next workshop visit Replace upper guide pulley for V-belt Model 164; 171; 211; 219; 221 with M272/M273 Accounting No. 2092010.

Dear All,

We are in receipt of the subject Service Measure from DAG for vehicle models 164; 171; 211; 219; 221 with M272/M273. The list of affected vehicles is attached herewith for your ready reference.

A noise-optimized guide pulley is available for these vehicles. In order to avoid any noise complaints at the belt drive, the upper guide pulley on the affected vehicles needs to be replaced as a precautionary measure. Please perform the work **during the next workshop visit of these vehicles**. Please refer to the attached work descriptions for the work procedures.

## Spare Parts, Operation texts and flat rates:

Please refer enclosed Work Instructions.

Damage code: 020920107.

Accounting No.: A warranty/goodwill claim for the costs of labour and material (if any) may be submitted to us, quoting the accounting number 2092010.

.....

Completion Deadline: This service measure should be completed by 31st December 2009.

For any queries you may have related to this information & activities, please contact the right undersigned or Mr. Devendra Thakur.

Please acknowledge receipt of this letter.

With best regards, Mercedes-Benz India Private Limited

D. Chandavarkar Director

After-Sales

Ashish Salvi

Dy. General Manager

Copies to - MBIPL Service Representatives - For close follow up with the workshops.

Encl. - Work Instructions

- Vehicle list Ref. e-mail

Ashish Rawal Ast

Redcoh Punchal. -

Petran Trinedi

Synish Nambiar -Nautten Vughela.

Jusmine Putel.

Trynesh Ruthod.

Field Service

- Dyroh

Registered office, Corporate Office & Works

21

Sector 15-A, Chiknuli Pimpri, Pime 411 018 (Indui) Phone: (+91) 20 2/505000 www.mercedes-benz.co.in

A Company of the Daimler Group

## WORK DESCRIPTION FOR SERVICE MEASURE

Code: 0710P20B12

Version: 2.0

Replace guide pulley A for V-belt

Model 164; 171; 211; 219; 221 with M272/M273

## **Work Procedure**

1. Remove engine cover.

2. Remove cap (A) (figure 1).

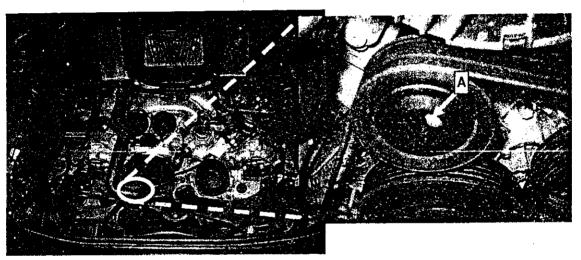


Figure 1

3. Detach V-belt (B) in area of guide pulley (C) (figure 2).

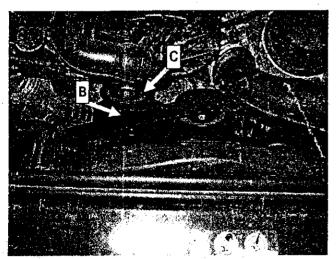


Figure 2

- 4. Replace guide pulley (C) (14m 30; figure 2).

  1 The cap can no longer be used!
- 5. Assemble in the reverse order.

Code: 0710P20B12 Version: 2.0

Parts		
Quantity	Designation	Part no.
1	Guide pulley	A 272 202 10 19 05

## **Operation Text and Flat Rate**

Operation no.	Operation text	Flat rate	Accounting no.	
02-5966-01	Replace guide pulley A for V-belt	0.5 hours	20 920 10	
02-5966-01	Replace guide pulley A for V-belt	0.6 hours	20 920 10	
	Model 171 and 236			

Mercedes-Benz Global Service & Parts