

Mercedes Benz

Mercedes-Benz India Private Limited

Pune, July 01, 2008

All Workshop Incharge  
MB India dealerships / ASC

**Service measure during next workshop stay**  
**Install engine control unit software**  
**Model 211 – E 280 CDI**

Dear All,

Please refer to the attached affected vehicle list. Modified software for the engine control unit is available for these vehicles. Diverse error messages and complaints about engine running characteristics can be avoided with this modified software. Hence, the software in the engine control unit on the affected vehicles needs to be updated. **This work is to be carried out during the vehicles' next visit to the workshop.** Please refer to the attached work instructions for the procedures.

**Parts required: None**

**For operation texts and flat rates, please refer to the attached work instructions.**

**Damage Code: 054940148**

**Cost settlement:**

A warranty/goodwill claim for the costs of material and labor can be submitted quoting **accounting number 5494014.**

**Completion deadline**

This field campaign should be completed by **31<sup>st</sup> December 2009.**

*Sir,*  
Total Six Cars affected-including one out of territory..... 2  
vehicle which stays at Mumbai

A Company of the Daimler Group

Registered office, Corporate Office & Works  
Sector 15-A, Chikhali  
Pimpri, Pune 411 018 (India)  
Phone: (+91) 20 27505000  
www.mercedes-benz.co.in

- ① 1/2 shop floor PL sph
- 2 Alok
- 3 Rakesh
- 4 Sunish

*Ashish*  
11/7/08

*Pune*  
5-7-08 - 1700h

5 Jasmin

: 2 :

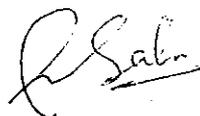
Please advise your concerned staff accordingly and ensure that each vehicle mentioned in the attached list visiting your workshop is attended for this action.

Please acknowledge receipt of this letter and feel free to revert to us for any queries.

Thanking you

With best regards,  
Mercedes-Benz India Private Limited

  
for D. Chandavarkar  
Director  
After-Sales

  
Ashish Salvi  
Dy. General Manager  
Field Service

Copy to - MBIL Service Representatives } for close follow up with the workshops

Encl. - Work Instructions  
- Affected vehicle list

## WORK DESCRIPTION FOR SERVICE MEASURE

Code: 0706P54A59

Version: 2.0

### Install engine control unit software

Model 211with OM642

- i** • Use **DAS version 09/2007** with AddOn 0792 or higher DAS version.
- Please make sure to follow the steps exactly as described in DAS.
- Use battery charger to ensure sufficient power supply from vehicle **on-board electrical system battery** (greater than 12.5 V).

### Work Procedure

1. Connect DAS.
2. Install engine control unit software.
  - i** To do so, select menu item: "Control units - Drive - CDI Common Rail Diesel Injection - Control unit adaptations - Control unit programming".
3. Code SCN engine control unit.
  - i** To do so, continue with menu item: "Control unit programming".
4. Disconnect DAS.

### Operation Text and Flat Rate

Operation no.	Operation text	Flat rate	Accounting no.
02-5791-01	Install engine control unit software	0.2 h	54 940 14
✓ 02-4762-01	Connect/disconnect Diagnosis Assistance System (DAS)	0.1 h	54 940 14
✓ 02-5382-01	Code control unit (with DAS connected)	0.1 h	54 940 14
✓ 02-5058-01	Connect/disconnect battery charger (with DAS connected)	0.1 h	54 940 14

DaimlerChrysler AG  
Global Service & Parts